
CITY OF BALTIMORE WET W SMOKE AND DYED W	Page 1 of 7	
Sewershed: JONES FALLS	Company: REI/DRAYCO	Date: 07/23/2008
Test to be Performed: SMOKE	Ground Condition: DRY	Supervisor: ER
Manhole ID: S35KK_026MH	Test ID: 0994-364	Notifications Made:_X (Residents, Fire, 311)

**Field Sketch:** (Show All Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)

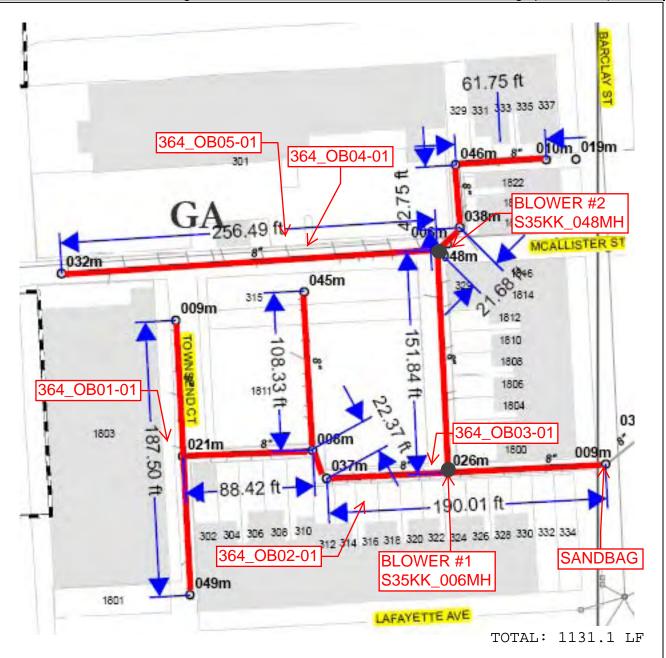

(		ATHER CONSENT DECREE ER TESTING FORM				Page 2 of 7			
Sewershed: JONES FALLS			Company: REI/DRAYCO				Date: 07/23/2008		
Test to be Performed:			Ground Condition:				Supervisor:E.R		
Smoke:X Dyed Water:			Dry: X	Dry: _X Damp: Wet:					
Manhole ID: S35KK_026MH			Test ID: 0994-364				Notifications Made:X (Residents, Fire, 311)		
Field Sketch: (Show all Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)									
Defect				Source Drainage					
No.	Address			Туре	Location	Sector	Area	Severity	Photo Number
1	1803 GUILFORD AVE.			02	08	02	3	03	364_OB01-01
2	316 E. LAFAYETTE AVE.			03	08	02	0	03	364_OB02-01
3	322 E. LAFAYETTE AVE.			16	12	01	0	02	364 OB03-01
4	317 E. NORTH AVE.			16	12	01	3	02	364_OB04-01
5	317 E. NORTH			03	02	02	1	02	364_OB05-01
3	317 E. NORTH	AVE.		03	02	02	'	02	304_0003-01
				OBSERVATION CODES					
	Source Type	Location	Sector	Severity		Source Type	Location		
01	Main Sewer	Paved Concrete	Public	No Smoke	10	MH Frame S	Non-Paved		
02	Service Line	Paved Asphalt	Private	Trace	11	Storm Drain	Field/Woods		
03	Cleanout	Paved Other		Moderate		Catch Basin/			
	Downspout	Driveway		Major		Storm Manh			
	Area Drain	Sidewalk				Storm Ditch	Other		
	Driveway Drain	Curb				Excavation			
	Stairwell Drain	Yard- Front			16	Other			
	Foundation Drain	Yard-Back							
09	Building Interior	Yard- Side					ĺ		

PAGE 3 OF 7

# CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 364 Date: 07/23/2008 Basin: JF-19

Defect No: OB-01 Supervisor: E.R. Dye Test Recommended: N

Address: 1803 GUILFORD AVE.

Source Type: 02 Location: 08 Severity: 03

Sector: 02 Drainage Area: 3

Comments: SMOKE COMING FROM GROUND BEHIND BUILDING ADJACENT TO TOWNSEND CT.

### SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01 Filename: 0994-364\_OB01-01.jpg

PAGE 4 OF 7

# CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 364 Date: 07/23/2008 Basin: JF-19

Defect No: OB-02 Supervisor: E.R. Dye Test Recommended: N

Address: 316 E. LAFAYETTE AVE.

Source Type: 03 Location: 08 Severity: 03

Sector: 02 Drainage Area: 0

Comments: CLEAN OUT - ABOVE GRADE - MISSING CAP

### SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01 Filename: 0994-364\_OB02-01.jpg

PAGE 5 OF 7

## CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 364 Date: 07/23/2008 Basin: JF-19

Defect No: OB-03 Supervisor: E.R. Dye Test Recommended: N

Address: 322 E. LAFAYETTE AVE.

Source Type: 16 Location: 12 Severity: 02

Sector: 01 Drainage Area: 0

Comments: SMOKE COMING FROM WATER VALVE MANHOLE IN ALLEY BEHIND 322 E. LAFAYETTE AVE.

### SMOKE TEST PHOTOGRAPHS



Photograph No: OB03-01 Filename: 0994-364\_OB03-01.jpg

PAGE 6 OF 7

## CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 364 Date: 07/23/2008 Basin: JF-19

Defect No: OB-04 Supervisor: E.R. Dye Test Recommended: N

Address: 317 E. NORTH AVE.

Source Type: 16 Location: 12 Severity: 02

Sector: 01 Drainage Area: 3

Comments: SMOKE COMING FROM BASE OF TELEPHONE POLE - EXTERIOR OF PARKING LOT FOR

APARTMENT BUILDING - MCALLISTER ST

### SMOKE TEST PHOTOGRAPHS



Photograph No: OB04-01 Filename: 0994-364\_OB04-01.jpg

PAGE 7 OF 7

## CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 364 Date: 07/23/2008 Basin: JF-19

Defect No: OB-05 Supervisor: E.R. Dye Test Recommended: N

Address: 317 E. NORTH AVE.

Source Type: 03 Location: 02 Severity: 02

Sector: 02 Drainage Area: 1

Comments: CLEAN OUT - BROKEN CAP - AT GRADE - LOCATION IS AT GATE FOR PARKING LOT OF

APARTMENT BUILDING - ENTRANCE IS ON MCALLISTER ST

### SMOKE TEST PHOTOGRAPHS



Photograph No: OB05-01 Filename: 0994-364\_OB05-01.jpg